

Tillamook High School

Tillamook SD 9

Till_sch03A

Building Type	County	
School	Tillamook	
Street		
2605 12Th St		
City	State	Zip
Tillamook	OR	97141
Latitude	Longitude	
45.44865	123.8361	
Tracking Code	Inspection Date	
SER & RVS2006	9/8/2006	



Seismicity Zone: Very High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	-2	-0.5	0	0	0	-0.8	0	0.5
Secondary	C2	2.8	-1	-0.5	0	0	0	-0.6	0	0.7
Tertiary	RM1	2.8	-1	-0.5	0	0	0	-0.6	0	0.7

Tillamook High School

Final RVS Score

Final Type Final Score

W2 0.5

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Tillamook High School

Till_sch03A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
744	1951	1951	1950
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
161977	1	No	Yes
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: Very Irregular Changes	
None		None	
None		None	
Falling Hazards		Poor Conditions	
Other: Brick Veneer		None	
Other: Ornamental Hazard Over Exit		None	
None		None	
			
NW Seismic Upgrade BUTTRESSES	NW Elevation View	SW Plan Irregularity Primary	
			
N Plan Irregularity Primary	N Building Name	N Elevation View	
			
NW Secondary Structural Type C2 PART	N Secondary Structural Type PLWD FORM MARKS	E Pounding Potential	




OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Tillamook High School

Till_sch03A

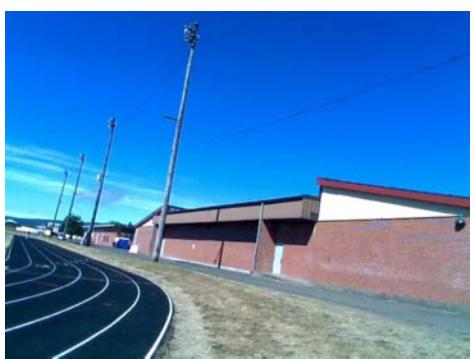

Tillamook High School

Tillamook SD 9

Till_sch03B

Building Type School	County Tillamook	
Street 2605 12Th St		
City Tillamook	State OR	Zip 97141
Latitude 45.44861	Longitude 123.835	
Tracking Code SER & RVS2006	Inspection Date 9/8/2006	



Seismicity Zone: Very High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	0	0	0	0	0	-0.8	0	3
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Tillamook High School

Final RVS Score

Final Type	Final Score
W2	3

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Tillamook High School

Till_sch03B

Enrollment 744	Year Built (Field Verified) 1951	Year Built (Alt. Source) 1951	Est. Decade Built 1960
Total Area (square ft) 161977	Number of Stories 1	Basement	Pounding Potential Yes
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards Other: Brick Veneer Other: Ornamental Hazard Over Exit None		Poor Conditions None None None	
			
W Pounding Potential		SE Elevation View	
		S Elevation View	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Tillamook High School

Tillamook SD 9

Till_sch03C

Building Type School	County Tillamook	
Street 2605 12Th St		
City Tillamook	State OR	Zip 97141
Latitude 45.44826	Longitude 123.83445	
Tracking Code SER & RVS2006	Inspection Date 9/8/2006	



Seismicity Zone: Very High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	PC1	2.6	0	0	0	0	0	-0.6	0	2
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Tillamook High School

Final RVS Score

Final Type	Final Score
PC1	2

FEMA-154 Collapse Potential

Moderate (>1%)



OregonGeology

Tillamook High School

Till_sch03C

Enrollment 744	Year Built (Field Verified) 1982	Year Built (Alt. Source) 1951	Est. Decade Built 1980
Total Area (square ft) 161977	Number of Stories 1	Basement	Pounding Potential Yes
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards Other: Ornamental Hazard Over Exit		Poor Conditions None None None	
			
NE Elevation View		SW Pounding Potential	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Tillamook High School

Tillamook SD 9

Till_sch03D

Building Type School	County Tillamook	
Street 2605 12Th St		
City Tillamook	State OR	Zip 97141
Latitude 45.44948	Longitude 123.83603	
Tracking Code SER & RVS2006	Inspection Date 9/8/2006	



Seismicity Zone: Very High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	0	0	0	2.4	0	-0.8	0	5.4
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Tillamook High School

Final RVS Score

Final Type	Final Score
W2	5.4

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Tillamook High School

Till_sch03D

Enrollment 744	Year Built (Field Verified) 1951	Year Built (Alt. Source) 1951	Est. Decade Built 1980
Total Area (square ft) 161977	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Out of Plane Lateral-Force-Resistance Elements None None		Vertical Irregularities Steps in Elevation View: 2 to 3 Changes None None	
Falling Hazards None None None		Poor Conditions None None None	
 NE Elevation View		 S Plan Irregularity Primary	
		 SW Elevation View	