

# Armand Larive Middle School

Umat\_sch07A

Hermiston SD 8

|                    |       |                 |  |
|--------------------|-------|-----------------|--|
| Building Type      |       | County          |  |
| School             |       | Umatilla        |  |
| Street             |       |                 |  |
| 199 E Ridgeway Ave |       |                 |  |
| City               | State | Zip             |  |
| Hermiston          | OR    | 97838           |  |
| Latitude           |       | Longitude       |  |
| 45.8424            |       | 119.28857       |  |
| Tracking Code      |       | Inspection Date |  |
| RVS in 2006        |       | 8/16/2006       |  |



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

|           | Type | Basic Score | Vert Irreg | Plan Irreg | Pre-Code | Post-Bench | Soil C | Soil D | Soil E | RVS Score |
|-----------|------|-------------|------------|------------|----------|------------|--------|--------|--------|-----------|
| Primary   | C2   | 3.6         | -2         | -0.5       | -0.4     | 0          | -0.8   | 0      | 0      | -0.1      |
| Secondary |      | 0           | 0          | 0          | 0        | 0          | 0      | 0      | 0      | 0         |
| Tertiary  |      | 0           | 0          | 0          | 0        | 0          | 0      | 0      | 0      | 0         |

Armand Larive Middle School

## Final RVS Score

Final Type

Final Score

C2

-0.1

FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

|                        |                             |                          |                    |
|------------------------|-----------------------------|--------------------------|--------------------|
| Enrollment             | Year Built (Field Verified) | Year Built (Alt. Source) | Est. Decade Built  |
| 466                    |                             | 1936                     | 1930               |
| Total Area (square ft) | Number of Stories           | Basement                 | Pounding Potential |
| 86410                  | 1                           | Yes                      | No                 |


|                             |                                                                    |
|-----------------------------|--------------------------------------------------------------------|
| Plan Irregularities         | Vertical Irregularities                                            |
| Reentrant Corners: L Shaped | Building On Hill or Sloped Site                                    |
| Reentrant Corners: Other    | Steps in Elevation View: 2 to 3 Changes (Adjacent Building/Entity) |
| None                        | None                                                               |

|                 |                 |
|-----------------|-----------------|
| Falling Hazards | Poor Conditions |
| None            | None            |
| None            | None            |
| None            | None            |



E Elevation View

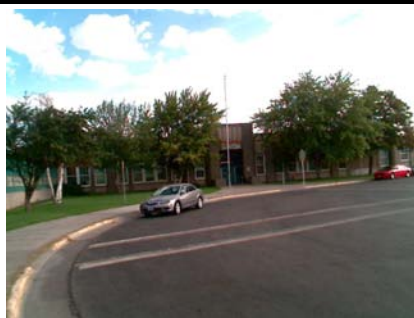

S Elevation View




# Armand Larive Middle School

Umat\_sch07B

Hermiston SD 8

|                    |       |                 |  |
|--------------------|-------|-----------------|--|
| Building Type      |       | County          |  |
| School             |       | Umatilla        |  |
| Street             |       |                 |  |
| 199 E Ridgeway Ave |       |                 |  |
| City               | State | Zip             |  |
| Hermiston          | OR    | 97838           |  |
| Latitude           |       | Longitude       |  |
| 45.84215           |       | 119.28912       |  |
| Tracking Code      |       | Inspection Date |  |
| RVS in 2006        |       | 8/16/2006       |  |

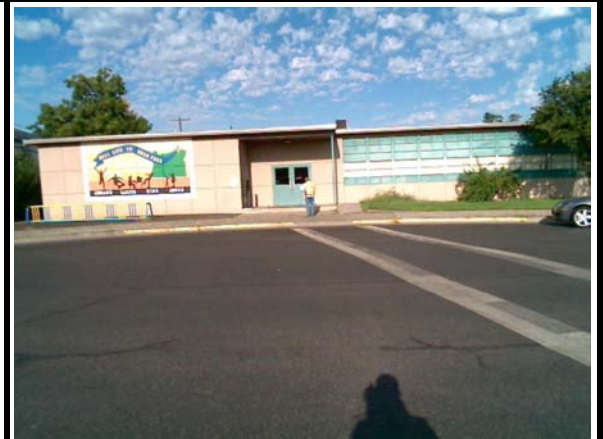

Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

|           | Type | Basic Score | Vert Irreg | Plan Irreg | Pre-Code | Post-Bench | Soil C | Soil D | Soil E | RVS Score |
|-----------|------|-------------|------------|------------|----------|------------|--------|--------|--------|-----------|
| Primary   | C2   | 3.6         | -2         | -0.5       | -0.4     | 0          | -0.8   | 0      | 0      | -0.1      |
| Secondary | PC1  | 3.2         | 0          | -0.5       | -0.2     | 0          | -0.6   | 0      | 0      | 1.9       |
| Tertiary  |      | 0           | 0          | 0          | 0        | 0          | 0      | 0      | 0      | 0         |

Armand Larive Middle School

## Final RVS Score

Final Type

Final Score

C2

-0.1

## FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

|                        |                             |                          |                    |
|------------------------|-----------------------------|--------------------------|--------------------|
| Enrollment             | Year Built (Field Verified) | Year Built (Alt. Source) | Est. Decade Built  |
| 466                    |                             | 1936                     | 1940               |
| Total Area (square ft) | Number of Stories           | Basement                 | Pounding Potential |
| 86410                  | 1                           | No                       | No                 |

|                                                  |                                                                    |
|--------------------------------------------------|--------------------------------------------------------------------|
| Plan Irregularities                              | Vertical Irregularities                                            |
| Reentrant Corners: Other (Adjacent Build/Entity) | Steps in Elevation View: 2 to 3 Changes (Adjacent Building/Entity) |
| Reentrant Corners: L Shaped                      | None                                                               |
| None                                             | None                                                               |

|                 |                 |
|-----------------|-----------------|
| Falling Hazards | Poor Conditions |
| None            | None            |
| None            | None            |
| None            | None            |



W Elevation View





# Armand Larive Middle School

Umat\_sch07C

Hermiston SD 8

|                    |       |                 |  |
|--------------------|-------|-----------------|--|
| Building Type      |       | County          |  |
| School             |       | Umatilla        |  |
| Street             |       |                 |  |
| 199 E Ridgeway Ave |       |                 |  |
| City               | State | Zip             |  |
| Hermiston          | OR    | 97838           |  |
| Latitude           |       | Longitude       |  |
| 45.84279           |       | 119.28851       |  |
| Tracking Code      |       | Inspection Date |  |
| RVS in 2006        |       | 8/16/2006       |  |



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

|           | Type | Basic Score | Vert Irreg | Plan Irreg | Pre-Code | Post-Bench | Soil C | Soil D | Soil E | RVS Score |
|-----------|------|-------------|------------|------------|----------|------------|--------|--------|--------|-----------|
| Primary   | C2   | 3.6         | -2         | -0.5       | 0        | 0          | -0.8   | 0      | 0      | 0.3       |
| Secondary |      | 0           | 0          | 0          | 0        | 0          | 0      | 0      | 0      | 0         |
| Tertiary  |      | 0           | 0          | 0          | 0        | 0          | 0      | 0      | 0      | 0         |

Armand Larive Middle School

## Final RVS Score

Final Type

Final Score

C2

0.3

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries


|                        |                             |                          |                    |
|------------------------|-----------------------------|--------------------------|--------------------|
| Enrollment             | Year Built (Field Verified) | Year Built (Alt. Source) | Est. Decade Built  |
| 466                    |                             | 1936                     | 1950               |
| Total Area (square ft) | Number of Stories           | Basement                 | Pounding Potential |
| 86410                  | 1                           | No                       | No                 |

|                                                  |                                                                   |
|--------------------------------------------------|-------------------------------------------------------------------|
| Plan Irregularities                              | Vertical Irregularities                                           |
| Reentrant Corners: Other (Adjacent Build/Entity) | Steps in Elevation View: Single Change (Adjacent Building/Entity) |
| None                                             | None                                                              |
| None                                             | None                                                              |

|                 |                 |
|-----------------|-----------------|
| Falling Hazards | Poor Conditions |
| None            | None            |
| None            | None            |
| None            | None            |



NE Elevation View

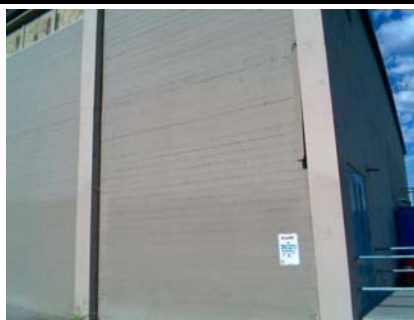

E Primary Structural Type



# Armand Larive Middle School

Umat\_sch07D

Hermiston SD 8

|                    |       |                 |  |
|--------------------|-------|-----------------|--|
| Building Type      |       | County          |  |
| School             |       | Umatilla        |  |
| Street             |       |                 |  |
| 199 E Ridgeway Ave |       |                 |  |
| City               | State | Zip             |  |
| Hermiston          | OR    | 97838           |  |
| Latitude           |       | Longitude       |  |
| 45.84198           |       | 119.28954       |  |
| Tracking Code      |       | Inspection Date |  |
| RVS in 2006        |       | 8/16/2006       |  |



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

|           | Type | Basic Score | Vert Irreg | Plan Irreg | Pre-Code | Post-Bench | Soil C | Soil D | Soil E | RVS Score |
|-----------|------|-------------|------------|------------|----------|------------|--------|--------|--------|-----------|
| Primary   | C2   | 3.6         | -2         | -0.5       | 0        | 0          | -0.8   | 0      | 0      | 0.3       |
| Secondary |      | 0           | 0          | 0          | 0        | 0          | 0      | 0      | 0      | 0         |
| Tertiary  |      | 0           | 0          | 0          | 0        | 0          | 0      | 0      | 0      | 0         |

Armand Larive Middle School

## Final RVS Score

Final Type

Final Score

C2

0.3

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

|                        |                             |                          |                    |
|------------------------|-----------------------------|--------------------------|--------------------|
| Enrollment             | Year Built (Field Verified) | Year Built (Alt. Source) | Est. Decade Built  |
| 466                    |                             | 1936                     | 1950               |
| Total Area (square ft) | Number of Stories           | Basement                 | Pounding Potential |
| 86410                  | 1                           | No                       | No                 |

|                                                    |                                                                   |
|----------------------------------------------------|-------------------------------------------------------------------|
| Plan Irregularities                                | Vertical Irregularities                                           |
| Reentrant Corners:T shaped (Adjacent Build/Entity) | Steps in Elevation View: Single Change (Adjacent Building/Entity) |
| None                                               | None                                                              |
| None                                               | None                                                              |

|                 |                 |
|-----------------|-----------------|
| Falling Hazards | Poor Conditions |
| None            | None            |
| None            | None            |
| None            | None            |



NW Elevation View





# Armand Larive Middle School

Umat\_sch07E

Hermiston SD 8

|                    |       |                 |  |
|--------------------|-------|-----------------|--|
| Building Type      |       | County          |  |
| School             |       | Umatilla        |  |
| Street             |       |                 |  |
| 199 E Ridgeway Ave |       |                 |  |
| City               | State | Zip             |  |
| Hermiston          | OR    | 97838           |  |
| Latitude           |       | Longitude       |  |
| 45.84255           |       | 119.28816       |  |
| Tracking Code      |       | Inspection Date |  |
| RVS in 2006        |       | 8/16/2006       |  |



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

|           | Type | Basic Score | Vert Irreg | Plan Irreg | Pre-Code | Post-Bench | Soil C | Soil D | Soil E | RVS Score |
|-----------|------|-------------|------------|------------|----------|------------|--------|--------|--------|-----------|
| Primary   | C2   | 3.6         | -2         | -0.5       | 0        | 0          | -0.8   | 0      | 0      | 0.3       |
| Secondary | PC1  | 3.2         | 0          | -0.5       | 0        | 0          | -0.6   | 0      | 0      | 2.1       |
| Tertiary  |      | 0           | 0          | 0          | 0        | 0          | 0      | 0      | 0      | 0         |

Armand Larive Middle School

## Final RVS Score

Final Type

Final Score

C2

0.3

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

|                        |                             |                          |                    |
|------------------------|-----------------------------|--------------------------|--------------------|
| Enrollment             | Year Built (Field Verified) | Year Built (Alt. Source) | Est. Decade Built  |
| 466                    |                             | 1936                     | 1960               |
| Total Area (square ft) | Number of Stories           | Basement                 | Pounding Potential |
| 86410                  | 1                           | No                       | No                 |

|                                                  |                                                                    |
|--------------------------------------------------|--------------------------------------------------------------------|
| Plan Irregularities                              | Vertical Irregularities                                            |
| Reentrant Corners: Other (Adjacent Build/Entity) | Steps in Elevation View: 2 to 3 Changes (Adjacent Building/Entity) |
| Reentrant Corners: Other                         | None                                                               |
| None                                             | None                                                               |

|                 |                 |
|-----------------|-----------------|
| Falling Hazards | Poor Conditions |
| None            | None            |
| None            | None            |
| None            | None            |



S Elevation View