


Dalles Police Dept

City of Dallas

Wasc_pol03A

Building Type Police - City	County Wasco	
Street 401 Court St E		
City The Dalles	State OR	Zip 97058
Latitude 45.60118	Longitude 121.18419	
Tracking Code RVS in 2006	Inspection Date 8/23/2006	

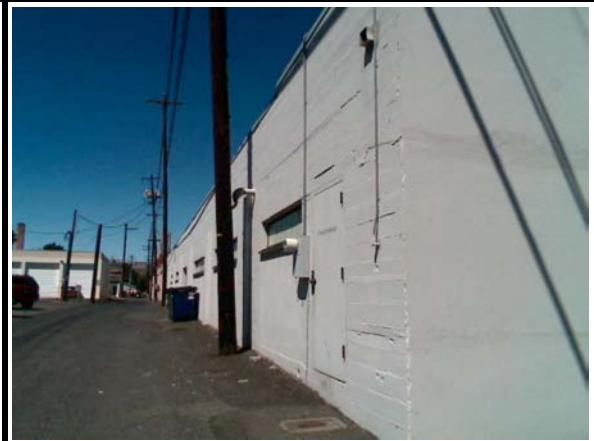

Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	0	-0.4	0	-0.8	0	0	0.4
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Dalles Police Dept

Final RVS Score

Final Type	Final Score
C2	0.4

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Dalles Police Dept

Wasc_pol03A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1930
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	2	No	Yes
Plan Irregularities		Vertical Irregularities	
None		Steps in Elevation View: Single Change	
None		None	
None		None	
Falling Hazards		Poor Conditions	
Heavy Cladding (thick stone or concrete)		None	
None		None	
None		None	
			
SE Number of Stories 2nd story added about 5 yrs ago		NE Elevation View	
		NE Vertical Irregularity Primary	
			
NW General Site		NW General Site	
		SW General Site	
			
N Primary Structural Type		N Primary Structural Type wall about 12" thick	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries