

Dry Hollow Elementary School

North Wasco County SD 21

Wasc_sch01A

Building Type School	County Wasco	
Street 1314 E 19th St		
City The Dalles	State OR	Zip 97058
Latitude 45.58679	Longitude 121.17296	
Tracking Code RVS in 2006	Inspection Date 8/24/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Secondary	W2	4.8	-3	-0.5	0	0	-0.8	0	0	0.5
Tertiary		0	0	0	0	0	0	0	0	0

Dry Hollow Elementary School

Final RVS Score

Final Type	Final Score
C2	0.3

FEMA-154 Collapse Potential

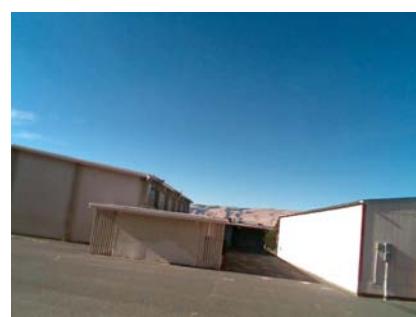
High (>10%)



OregonGeology

Dry Hollow Elementary School

Wasc_sch01A

Enrollment 456	Year Built (Field Verified) 1960	Year Built (Alt. Source) 1960	Est. Decade Built 1960
Total Area (square ft) 36016	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: Single Change	
Out of Plane Lateral-Force-Resistance Elements		None	
None		None	
Falling Hazards		Poor Conditions	
Other: Ornamental Hazard Over Exit		None	
None		None	
None		None	
	NE Plan Irregularity Secondary		NE Plan Irregularity Secondary
	N Falling Hazard		
	NW Plan Irregularity Secondary		W Elevation View
	W Vertical Irregularity Primary		
	W Primary Structural Type c2 on gym		S Plan Irregularity Primary
	E Elevation View		



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Dry Hollow Elementary School

Wasc_sch01A



E Elevation View



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries