

# The Dalles-Wahtonka High School (The Dalles Camp)

North Wasco County SD 21

Wasc\_sch05A

Building Type	County
School	Wasco
Street	
220 E 10th St	
City	State Zip
The Dalles	OR 97058
Latitude	Longitude
45.59564	121.18794
Tracking Code	Inspection Date
RVS in 2006	8/23/2006



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	-0.5	-0.4	0	0	0	0	0.7
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

The Dalles-Wahtonka High School  
(The Dalles Campus)

## Final RVS Score

Final Type	Final Score
C2	0.7

## FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# The Dalles-Wahtonka High School (The Dalles Campus)

Wasc\_sch05A

Enrollment 966	Year Built (Field Verified) 1940	Year Built (Alt. Source) 1940	Est. Decade Built 1940
Total Area (square ft)	Number of Stories 2	Basement	Pounding Potential Yes
Plan Irregularities		Vertical Irregularities	
Out of Plane Lateral-Force-Resistance Elements		Steps in Elevation View: 2 to 3 Changes	
Reentrant Corners: Other (Adjacent Build/Entity)		Building On Hill or Sloped Site	
None		Steps in Elevation View: Single Change (Adjacent Building/Entity)	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	
			
N Pounding Potential a and d		NE Vertical Irregularity Secondary	
		SE Elevation View	
		E Elevation View	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# The Dalles-Wahtonka High School (The Dalles Camp)

North Wasco County SD 21

Wasc\_sch05B

Building Type	County
School	Wasco
Street	
220 E 10th St	
City	State Zip
The Dalles	OR 97058
Latitude	Longitude
45.59624	121.18774
Tracking Code	Inspection Date
RVS in 2006	8/23/2006



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	-0.5	-0.4	0	0	0	0	0.7
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

The Dalles-Wahtonka High School  
(The Dalles Campus)

## Final RVS Score

Final Type	Final Score
C2	0.7

## FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# The Dalles-Wahtonka High School (The Dalles Campus)

Wasc\_sch05B

Enrollment 966	Year Built (Field Verified) 1940	Year Built (Alt. Source) 1940	Est. Decade Built 1940
Total Area (square ft) 	Number of Stories 2	Basement	Pounding Potential Yes
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: Very Irregular Changes	
Reentrant Corners: Other (Adjacent Build/Entity)		Building On Hill or Sloped Site	
None		Steps in Elevation View: Single Change (Adjacent Building/Entity)	
Falling Hazards		Poor Conditions	
Other: Smokestack		None	
None		None	
None		None	



N Primary Structural Type  
form marks



E Elevation View



N Other



NE Building Name



N Vertical Irregularity Secondary



N Basement



N Pounding Potential



SW Plan Irregularity Primary



W Falling Hazard



# OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries



W Elevation View



# The Dalles-Wahtonka High School (The Dalles Camp)

North Wasco County SD 21

Wasc\_sch05C

Building Type	County
School	Wasco
Street	
220 E 10th St	
City	State Zip
The Dalles	OR 97058
Latitude	Longitude
45.5967	121.18869
Tracking Code	Inspection Date
RVS in 2006	8/23/2006



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	0	0	0	0	0	0	0	3.6
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

The Dalles-Wahtonka High School  
(The Dalles Campus)

## Final RVS Score

Final Type	Final Score
RM1	3.6

## FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# The Dalles-Wahtonka High School (The Dalles Campus)

Wasc\_sch05C

Enrollment 966	Year Built (Field Verified) 1940	Year Built (Alt. Source) 1940	Est. Decade Built 1970
Total Area (square ft)	Number of Stories 1	Basement	Pounding Potential Yes
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: Very Irregular Changes	
Reentrant Corners: Other (Adjacent Build/Entity)		Steps in Elevation View: Single Change (Adjacent Building/Entity)	
None		Building On Hill or Sloped Site	
Falling Hazards		Poor Conditions	
Other: Light Cladding		None	
None		None	
None		None	
			
NW Primary Structural Type		NW Primary Structural Type	
		NW Vertical Irregularity Primary	
			
SW Plan Irregularity Primary		SW Vertical Irregularity Tertiary	
		S General Site conn to b	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# The Dalles-Wahtonka High School (The Dalles Camp)

North Wasco County SD 21

Wasc\_sch05D

Building Type	County	
School	Wasco	
Street		
220 E 10th St		
City	State	Zip
The Dalles	OR	97058
Latitude	Longitude	
45.5958	121.18833	
Tracking Code	Inspection Date	
RVS in 2006	8/23/2006	



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	0	0	0	1.1
Secondary	C1	3	-2	-0.5	0	0	0	0	0	0.5
Tertiary	C3	3.2	-2	-0.5	0	0	0	0	0	0.7

The Dalles-Wahtonka High School  
(The Dalles Campus)

## Final RVS Score

Final Type	Final Score
C1	0.5

## FEMA-154 Collapse Potential

High (>10%)

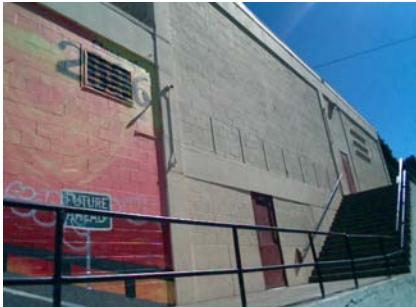


OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# The Dalles-Wahtonka High School (The Dalles Campus)

Wasc\_sch05D

Enrollment 966	Year Built (Field Verified) 1940	Year Built (Alt. Source) 1940	Est. Decade Built 1950
Total Area (square ft)	Number of Stories 1	Basement	Pounding Potential Yes
Plan Irregularities Reentrant Corners:Other (Adjacent Build/Entity) None None		Vertical Irregularities Steps in Elevation View: Single Change (Adjacent Building/Entity) Building On Hill or Sloped Site Steps in Elevation View: Single Change	
Falling Hazards None None None		Poor Conditions None None None	
 NW Primary Structural Type		 W Primary Structural Type	
		 N Elevation View	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# The Dalles-Wahtonka High School (The Dalles Camp)

North Wasco County SD 21

Wasc\_sch05E

Building Type	County
School	Wasco
Street	
220 E 10th St	
City	State Zip
The Dalles	OR 97058
Latitude	Longitude
45.5961	121.18817
Tracking Code	Inspection Date
RVS in 2006	8/23/2006



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	0	0	0	0	0	0	0	3.6
Secondary	C1	3	0	0	0	0	0	0	0	3
Tertiary	C3	3.2	0	0	0	0	0	0	0	3.2

The Dalles-Wahtonka High School  
(The Dalles Campus)

## Final RVS Score

Final Type	Final Score
C1	3

## FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# The Dalles-Wahtonka High School (The Dalles Campus)

Wasc\_sch05E

Enrollment 966	Year Built (Field Verified) 1940	Year Built (Alt. Source) 1940	Est. Decade Built 1950
Total Area (square ft)	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	
 W Primary Structural Type		 SW Elevation View	
		 E Elevation View	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries