

TVF & R - Station 65 West Slope

Wash_fir07A

Tualatin Valley F&R

Building Type		County	
Fire - RFPD		Washington	
Street			
8661 Sw Canyon Dr			
City	State	Zip	
Portland	OR	97225	
Latitude		Longitude	
45.49897		122.76605	
Tracking Code		Inspection Date	
To be Retrofit		6/28/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Secondary	W1	4.4	-2.5	-0.5	0	0	0	0	0	1.4
Tertiary	C2	2.8	-1	-0.5	0	0	-0.4	0	0	0.9

TVF & R - Station 65 West Slope

Final RVS Score

Final Type

Final Score

RM1

0.9

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

TVF & R - Station 65 West Slope

Wash_fir07A

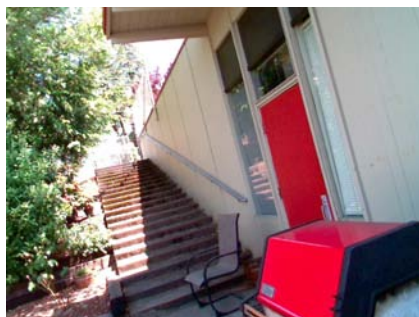
Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
		1968	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
7667	1	No	No

Plan Irregularities	Vertical Irregularities
Torsion: Eccentric Stiffness	Building On Hill or Sloped Site
None	Steps in Elevation View: 2 to 3 Changes
None	None

Falling Hazards	Poor Conditions
Other: General	None
None	None
None	None

SW Primary Structural Type
rm1

S General Site

W Secondary Structural Type
W1SW Vertical Irregularity Primary
Sloped hill

N Vertical Irregularity Secondary

SW Secondary Structural Type
concrete retaining wall on East side