

Forest Grove Police Dept

City of Forest Grove

Wash_pol03A

Building Type Police - City	County Washington	
Street 2102 Pacific Ave		
City Forest Grove	State OR	Zip 97116
Latitude 45.5194	Longitude 123.10995	
Tracking Code RVS in 2006	Inspection Date 7/12/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	S1	2.8	0	-0.5	0	0	-0.4	0	0	1.9
Secondary	S2	3	0	-0.5	0	0	-0.4	0	0	2.1
Tertiary	RM1	2.8	0	-0.5	0	0	-0.4	0	0	1.9

Forest Grove Police Dept

Final RVS Score

Final Type	Final Score
S1	1.9

FEMA-154 Collapse Potential

Moderate (>1%)

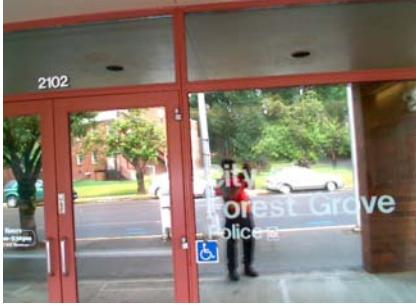
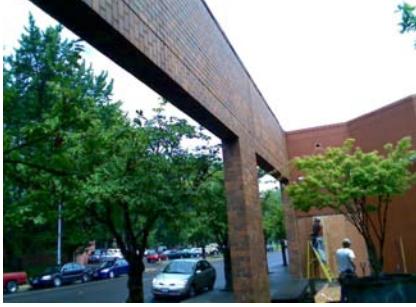


OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Forest Grove Police Dept

Wash_pol03A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1978	1978	1970
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	Yes
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		None	
Torsion: Building Shape		None	
Non-Parallel System		None	
Falling Hazards		Poor Conditions	
Other: General		None	
None		None	
None		None	
			
NE Primary Structural Type bad photo from a dark room in the library next door, same const as the police station. There is a steel column on the left and a steel beam above the		NW Primary Structural Type library next door, same const as the police station. There is a steel column you can see where moment resisting beams were cut out.	
			
NE General Site		W General Site	
			
SW General Site		S General Site	
			
W General Site			
			
NE Falling Hazard			



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries