

# Tom McCall Upper Elementary

Forest Grove SD 15

Wash\_sch21A

Building Type	County	
School	Washington	
Street		
1341 Pacific Ave		
City	State	Zip
Forest Grove	OR	97116
Latitude	Longitude	
45.52089	123.12303	
Tracking Code	Inspection Date	
RVS in 2006	7/13/2006	



Seismicity Zone: High

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	2.8	-1	-0.5	0	0	0	-0.6	0	0.7
Secondary	RM1	2.8	-1	-0.5	0	0	0	-0.6	0	0.7
Tertiary		0	0	0	0	0	0	0	0	0

Tom McCall Upper Elementary

## Final RVS Score

Final Type	Final Score
C2	0.7

## FEMA-154 Collapse Potential

High (>10%)



OregonGeology

# Tom McCall Upper Elementary

Wash\_sch21A

Enrollment 905	Year Built (Field Verified) 1952	Year Built (Alt. Source) 1952	Est. Decade Built 1950
Total Area (square ft) 114708	Number of Stories 1	Basement	Pounding Potential Yes
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: 2 to 3 Changes	
Reentrant Corners: Other (Adjacent Build/Entity)		Steps in Elevation View: Single Change (Adjacent Building/Entity)	
None		None	
Falling Hazards		Poor Conditions	
Unreinforced Chimneys		Cracks	
None		None	
None		None	



E General Site  
new bldg on left bldg A on right



NE General Site



N General Site




NW Primary Structural Type




W General Site



SW General Site

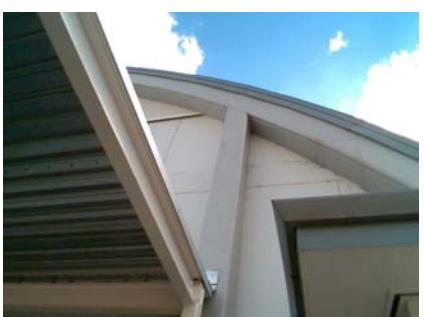

SW Primary Structural Type

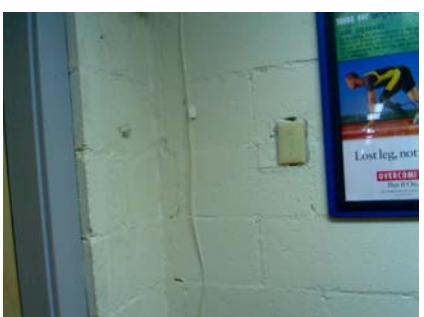

N Secondary Structural Type  
RM1 inside



W General Site



# OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries



S Tertiary Structural Type  
glulam beams



SW Field Verified Year Built  
1952



NE Seismic Upgrade  
no visible seismic joint between bldg A and new construction.



SW Vertical Irregularity Primary



W Falling Hazard  
chimney