

Mary Woodward Elementary School

Wash_sch30A

Tigard-Tualatin SD 23J

Building Type		County	
School		Washington	
Street			
12325 Sw Katherine St			
City	State	Zip	
Tigard	OR	97223	
Latitude		Longitude	
45.43376		122.80391	
Tracking Code		Inspection Date	
RVS in 2006		7/11/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	-2	-0.5	0	2.4	-0.4	0	0	3.3
Secondary	C2	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Tertiary		0	0	0	0	0	0	0	0	0

Mary Woodward Elementary School

Final RVS Score

Final Type

Final Score

C2

0.9

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries


Mary Woodward Elementary School

Wash_sch30A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
537		1980	1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
48798	1	No	Yes

Plan Irregularities	Vertical Irregularities
Reentrant Corners: Other	Steps in Elevation View: 2 to 3 Changes
Reentrant Corners: T shaped (Adjacent Build/Entity	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None

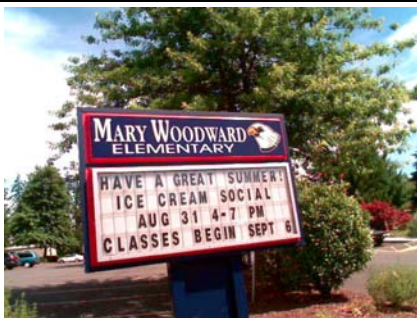

SW Building Name



E General Site



SE General Site



W General Site



NW General Site



NW Vertical Irregularity Primary



W Pounding Potential



NW General Site

Mary Woodward Elementary School

Wash_sch30B

Tigard-Tualatin SD 23J

Building Type		County	
School		Washington	
Street			
12325 Sw Katherine St			
City	State	Zip	
Tigard	OR	97223	
Latitude		Longitude	
45.43431		122.80383	
Tracking Code		Inspection Date	
RVS in 2006		7/11/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	PC1	2.6	0	-0.5	0	0	-0.4	0	0	1.7
Secondary	W2	3.8	-2	-0.5	0	2.4	-0.4	0	0	3.3
Tertiary		0	0	0	0	0	0	0	0	0

Mary Woodward Elementary School

Final RVS Score

Final Type

Final Score

PC1

1.7

FEMA-154 Collapse Potential

Moderate (>1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries


Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
537		1980	1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
48798	1	No	Yes

Plan Irregularities	Vertical Irregularities
Torsion: Eccentric Stiffness	Steps in Elevation View: Single Change
Reentrant Corners: T shaped	Steps in Elevation View: Single Change (Adjacent Building/Entity)
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None



SE General Site

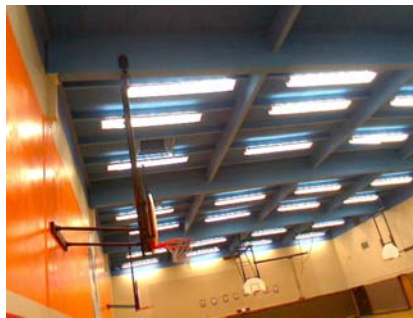NE Primary Structural Type
PC1 walls Timber roofNW Primary Structural Type
PC1 on right side W2 on left.

NW General Site



NE General Site



E General Site