


# Mountain View Middle School

Beaverton SD 48J

Wash\_sch70A

Building Type	County	
School	Washington	
Street		
17500 Sw Farmington Rd		
City	State	Zip
Beaverton	OR	97007
Latitude	Longitude	
45.47929	122.85574	
Tracking Code	Inspection Date	
Structural Engineering Report		
9/15/2006		

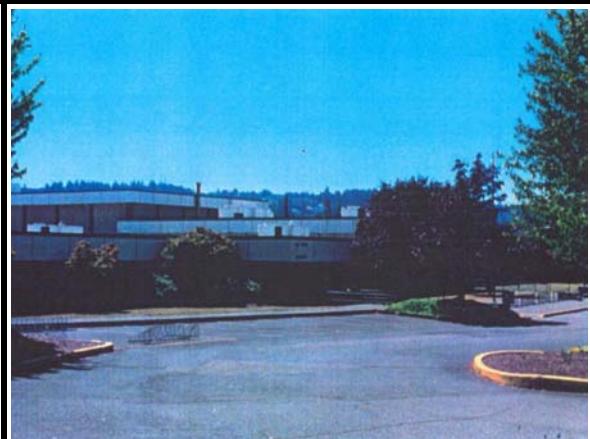

Seismicity Zone: High

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	S1	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Secondary	RM2	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Tertiary		0	0	0	0	0	0	0	0	0

Mountain View Middle School

### Final RVS Score

Final Type	Final Score
S1	0.9

### FEMA-154 Collapse Potential

High (>10%)

No  
Planview  
Available



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Mountain View Middle School

Wash\_sch70A

Enrollment 1046	Year Built (Field Verified) 1968	Year Built (Alt. Source) 1968	Est. Decade Built 1960
Total Area (square ft) 136296	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners:L shaped Large Diaphragm or Central Opening		Vertical Irregularities Steps in Elevation View: Single Change	
Falling Hazards None None None		Poor Conditions None None None	
 S General Site			



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries