

Sheridan Fire District

City of Sheridan

Yamh_fir03A

Building Type	County	
Fire - City	Yamhill	
Street		
230 Sw Mill St		
City	State	Zip
Sheridan	OR	97378
Latitude	Longitude	
45.09671	123.39716	
Tracking Code	Inspection Date	
RVS in 2006	8/14/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	0	0	0	-0.4	0	0	1.4
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Sheridan Fire District

Final RVS Score

Final Type	Final Score
RM1	1.4

FEMA-154 Collapse Potential

Moderate (>1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Sheridan Fire District

Yamh_fir03A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1983	1983	1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	2	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: L Shaped		Steps in Elevation View: 2 to 3 Changes	
Torsion: Eccentric Stiffness		None	
None		None	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	



N Plan Irregularity Primary



N Primary Structural Type



NW Plan Irregularity Secondary



NW Vertical Irregularity Primary



NW Secondary Structural Type
concrete over doors



SE Building Quality



W Elevation View



SW Elevation View



NW Plan Irregularity Primary




OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries



E Field Verified Year Built
1983

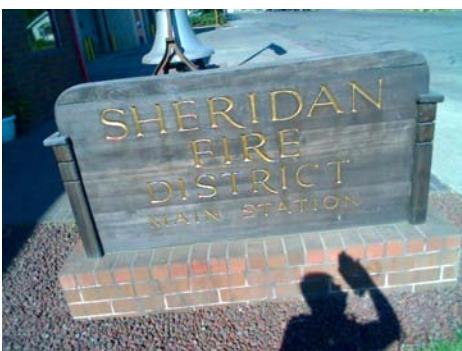

NE Building Name